


Model: BOTTEGA WHITE ANT.L 59,6X59,6(A) Codes: 100326936 Water absorption: BIa - Porcelanico (E<=0.1%)

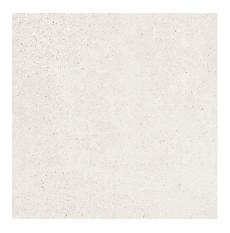

Sistema DAPc<sup>®</sup> Declaración Ambiental de Productos de Construcción

DIMENSIONAL FEATURES UNE-EN ISO 10545-2			
Thickness	8.5 MM	+/-5%*	
Width	596 MM		
Length	596 MM		
Length and width deviation	Below 0.15%	+/-0.3%*	
Side straightness deviation	Below 0.15%	+/-0.3%*	
Squareness deviation	Below 0.15%	+/-0.3%*	
Surface flatness deviation	Below 0.15%	+/-0.4%*	
*ISO-13006:2018 UNE-EN 14411:2016			

MECHANICAL FEATURES UNE-EN ISO 10545-4-6-7-11			
Breaking strength	2338.2 N	>1300N*	
Modulus of rupture	54.8 N/MM2	>=35N/mm2*	
Abrasion resistance	PEI 4 / 1500v		
Crazing resistance	Resists 3 cycles		
*ISO-13006:2018 UNE-EN 14411:2016			

HYGIENIC FEATURES UNE-EN ISO 10545-13-14:1995		
Chemical resistance	Class "A" for swimming pools and cleaning products (resists attack). Minimum Class "B" for acids and bases	B Min.*
Stain resistance	Class 5. Easy cleaning with water	3 Min.*
*ISO-13006:2018 UNE-EN 14411:2016		

	SCOPE OF USE	
Technical code-1	Use on heavy traffic floors	
	ANTI-SLIP VALUE EN 16165: 2022 / ASTM C1028	
Dynamic coefficient of friction	>0,42	
Slip resistance (pendulum-wet)	CL3	
4s	WET-51 / DRY-59	
*ICO 42000 2040 UNE EN 44444 2040		

\*ISO-13006:2018 UNE-EN 14411:2016



- Do not use cleaning agents containing hydrofluoric acid. It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint. For big sizes, it is recomended to fix with mortars containing polymeric additives and to use the double glueing technique. Mosaic tiles must be grouted. This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.

## 100326936 BOTTEGA WHITE ANT. L

## PORCELANOSA Grupo

	PACKING	
Sales units per box	1.776073 M2/BOX	
Sales units per pallet	56.834328 M2/PAL	
Sales units per unit	0.355215 M2/PIECE	



Do not use cleaning agents containing hydrofluoric acid. It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint. For big sizes, it is recomended to fix with mortars containing polymeric additives and to use the double glueing technique. Mosaic tiles must be grouted. This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.