


Model: AVENUE WHITE TEXT.ANT.L 59,6X59,6(A)

Codes: 100325479

Water absorption: Bla - Porcelánico ( $E \leq 0.1\%$ )

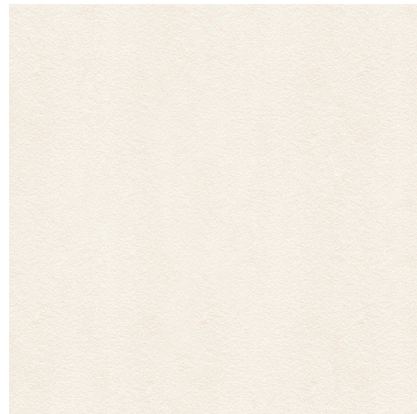

## DIMENSIONAL FEATURES

UNE-EN ISO 10545-2

Thickness	8.5 MM	+/-5%*
Width	596 MM	
Length	596 MM	
Length and width deviation	Below 0.15%	+/-0.3%*
Side straightness deviation	Below 0.15%	+/-0.3%*
Squareness deviation	Below 0.15%	+/-0.3%*
Surface flatness deviation	Below 0.15%	+/-0.4%*

\*ISO-13006:2018 UNE-EN 14411:2016

## MECHANICAL FEATURES

UNE-EN ISO 10545-4-6-7-11

Breaking strength	2338.2 N	>1300N*
Modulus of rupture	54.8 N/MM <sup>2</sup>	>=35N/mm <sup>2</sup> *
Crazing resistance	Resists 3 cycles	

\*ISO-13006:2018 UNE-EN 14411:2016

## HYGIENIC FEATURES

UNE-EN ISO 10545-13-14:1995

Chemical resistance	Class "A" for swimming pools and cleaning products (resists attack). Minimum Class "B" for acids and bases	B Min.*
Stain resistance	Class 5. Easy cleaning with water	3 Min.*

\*ISO-13006:2018 UNE-EN 14411:2016

## SCOPE OF USE

Technical code-1	Use on heavy traffic floors	
------------------	-----------------------------	--

## ANTI-SLIP VALUE

EN 16165: 2022 / ASTM C1028

Dynamic coefficient of friction	>0,42	
Slip resistance (pendulum-wet)	CL3	
4s	WET-61 / DRY-68	

\*ISO-13006:2018 UNE-EN 14411:2016

System Certification



Do not use cleaning agents containing hydrofluoric acid.

It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.

For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double gluing technique.

Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.

## PACKING

Sales units per box	1.776073 M2/BOX	
Sales units per pallet	56.834328 M2/PAL	
Sales units per unit	0.355215 M2/PIECE	

### System Certification



Do not use cleaning agents containing hydrofluoric acid.  
It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.  
For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double glueing technique.  
Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.